


# MATERIAL SAFETY DATA SHEET

## GAF MATERIALS CORPORATION

GAF splice Tape Primer

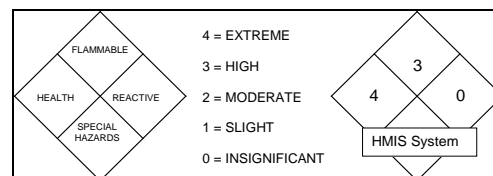

GAF splice Tape Primer		GAF splice Tape Primer	
<b>Manufacturer</b>	GAF MATERIALS CORPORATION	<b>Identity (Trade Name As Used On Label)</b>	
<b>Address</b>	1361 Alps Road	<b>MSDS Number*</b>	1084
	Wayne, NJ 07470	<b>CAS Number*</b>	None
<b>Phone Number (For Information)</b>	800-766-3411	<b>Date Prepared</b>	03/19/01 REV 06/03
<b>Emergency Phone Number</b>	800-424-9300	<b>Prepared By*</b>	Bill Kuhn

NOTE: Blank spaces are not permitted. If any item is not applicable, or no information is available; the space must be marked to indicate that.

SECTION 1 - MATERIAL IDENTIFICATION AND INFORMATION				
COMPONENTS - Chemical Name & Common Names (Hazardous Components 1% or Greater; Carcinogens 0.1% or greater)	%*	OSHA PEL-TWA	ACGIH TLV-TWA	OTHER LIMITS RECOMMENDED
Toluene (CAS# 108-88-3) (Section 313 Reportable)	14.22	50 ppm	100 ppm	
Hexane (CAS# 110-54-003) (Section 313 Reportable)	3.95	50 ppm	50 ppm	
Diphenylmethane Diisocyanate (CAS#026447-40-5) (Section 313 Reportable)	0.225			
Xylene (CAS # 1330-20-7)	76.57	50 ppm	100 ppm	
Polymethylene Polyphenol Isocyanate (CAS# 009016-87-9)	0.225			
Non-Hazardous Ingredients	4.81			
<b>Total</b>	<b>100</b>			

SECTION 2 - PHYSICAL/CHEMICAL CHARACTERISTICS			
Boiling Point	150/232	Specific Gravity (H <sub>2</sub> O = 1)	0.865
Vapor Pressure (mm Hg and Temperature)	140.0 mmHg @ 20C	Flashpoint	-20F
Vapor Density (Air = 1)	3.0 (Air = 1)	Evaporation Rate (Butyl Acetate = 1)	8.1
VOC (less water and exempt solvent)	819.8 g/liter	Volatile (% Wt or % Vol)	95.5 % Vol
Static Electricity Explosion	Yes, ground clip needed for large quantities and in closed areas	Density	7.21 lb/gal
Appearance and Odor: Thin amber syrup liquid and solvent odor			

SECTION 3 - FIRE AND EXPLOSION HAZARD DATA						
Flash Point and  - 20F TCC		Auto-Ignition  447F		Flammability Limits in	LEL	UEL
Method Used		Temperature		Air % by Volume	1% volume in Air	8.0 % vol. in Air
<b>Extinguisher Media</b> Dry chemical, carbon dioxide, foam water spray or fog, and vaporizing liquid type extinguishing agents may all be suitable. Water may be an ineffective extinguishing agent unless used under favorable conditions by experienced fire fighters trained in fighting all types of flammable liquid fires.						
<b>Special Fire Fighting Procedures</b> Wear a self-contained breathing apparatus with a full face piece operated in the positive pressure demand mode with appropriate turn-out gear and chemical resistant PPE. Avoid spreading burning liquids with water used for cooling purposes. Fire protection and fire response strategy should be planned through consultation with local fire protection authorities or appropriate specialists						
<b>Unusual Fire and Explosion Hazards</b> Material is flammable and volatile. Vapors are heavier than air and may travel along the ground or may be moved by ventilation and ignited by pilot lights, other flames, sparks, heaters, smoking electric motors, static discharge, or other ignition source at locations distant from material handling point. Avoid open flames and other ignition sources in storage and in use, especially in spray applications. Not to be used where inadequate ventilation is likely or where vapor concentrations are flammable.						

SECTION 4 - REACTIVITY HAZARD DATA	
<b>STABILITY</b>	Stable <input checked="" type="checkbox"/> Unstable <input type="checkbox"/>
<b>Conditions To Avoid</b>	Avoid exposure to heat, sparks, open flames and all source of ignition
<b>Incompatibility (Materials to Avoid):</b>	Avoid contact with strong oxidizing agents
<b>Hazardous Decomposition Products</b>	
<b>HAZARDOUS POLYMERIZATION</b>	
<input type="checkbox"/> May Occur <input checked="" type="checkbox"/> Will Not Occur	

\* Optional

Page 1 / 2

SECTION 5 – HEALTH HAZARD DATA
--------------------------------

PRIMARY ROUTES OF ENTRY: <input checked="" type="checkbox"/> Inhalation <input checked="" type="checkbox"/> Skin Absorption <input type="checkbox"/> Ingestion <input type="checkbox"/> Not Haz		CARCINOGEN LISTED IN: <input type="checkbox"/> NTP <input type="checkbox"/> IARC Monograph <input type="checkbox"/> OSHA <input checked="" type="checkbox"/> Not Listed
<b>HEALTH</b>	Acute irritation can occur for short term overexposure	
<b>HAZARDS</b>	Chronic (See below)	
<b>Signs and Symptoms of Exposure:</b> Inhalation: May cause central nervous system depression. Inebriation followed by headache and nausea. In severe cases dizziness, convulsions, and unconsciousness. Anorexia and nervousness may persist for several months following acute overexposure. Eyes may burn and irritate eyes and mucus membranes. May cause dermatitis and defatting of the skin. Harmful or fatal if swallowed.		
<b>Medical Conditions Generally Aggravated by Repeated Overexposure:</b> Prolonged occupational overexposure to organic solvents could be associated with various neurotoxic effects including permanent brain and nervous system damage. Symptoms include loss of memory, loss of intellectual ability and loss of coordination. Chronic skin exposure to skin may cause similar effects		
<b>EMERGENCY FIRST AID PROCEDURES -</b>		
<b>Eye Contact</b>	Flush eyes gently with water for at least 15 minutes while holding eyelids apart. Consult physician.	
<b>Skin Contact</b>	Wash exposed skin area with soap and water. Consult physician if irritation persists. Launder contaminated clothing before reuse.	
<b>Inhalation</b>	Remove individual to fresh air. If breathing is difficult administer oxygen. If breathing has stopped begin artificial respiration. Seek immediate medical attention.	
<b>Ingestion</b>	Do not induce vomiting. Seek medical attention.	
<b>Note to physician:</b> Any treatment that might be required for overexposure should be directed at the control of symptoms and the clinical condition.		

## SECTION 6 - CONTROL AND PROTECTIVE MEASURES

<b>Respiratory Protection (Specify Type)</b> If the TLV or PEL for the product or any component is exceeded in the workplace air, a NIOSH/OSHA approved respirator is advised. Engineering controls should be implemented to reduce exposure.		
<b>Protective Gloves:</b> The use of chemical resistant gloves is recommended. Wear impervious clothing if necessary.		<b>Eye Protection</b> - Chemical splash goggles are advised.
<b>VENTILATION</b>	<input checked="" type="checkbox"/> Local Exhaust - Class I, Group D preferable	
<b>TO BE USED</b>	<input type="checkbox"/> Special	<input checked="" type="checkbox"/> Mechanical (General)
<b>Other Protective Clothing and Equipment</b> If necessary, wear impervious clothing and boots		
<b>Hygienic Work Practices</b> Practice safe working procedures and good personal hygiene. Use PPE when necessary. Wash thoroughly after handling and before eating, drinking, smoking, or toilet facilities.		

## SECTION 7 - PRECAUTIONS FOR SAFE HANDLING AND USE/LEAK PROCEDURES

<b>Steps to be Taken if Material is Spilled or Released</b> Eliminate all ignition sources such as flames (including pilot lights), electric sparks, etc. Stop spill at source. Contain spilled liquid with sand, earth, vermiculite or other inert absorbent material. This material is a water pollutant and should be prevented from contaminating soil or from entering sewage and drainage systems and other bodies of water. Notify authorities.
<b>Waste Disposal Methods</b> This material is considered a hazardous waste. Do not flush to sewer. Dispose of in accordance with all applicable federal, state or provincial, and local laws and regulations. RCRA hazardous material 40 CFR PART 261 subpart C.
<b>Transportation requirements</b> - DOT proper shipping name: Adhesive. DOT Classification: 3. ID #: UN1133. Packing Group #: II
<b>Precautions to be Taken in Handling and Storage</b> Handle with reasonable care. Avoid breathing vapors, spray mist, eye contact, and repeated or prolonged skin contact. Observe appropriate static grounding procedures for flammable liquids. Do not transfer in unmarked container. Containers may be hazardous when emptied because of residue retained. Thoroughly evaluated and safe operating conditions must be established and maintained. Containers should be grounded when pouring. Avoid free fall of liquid. Do not cut, braze or weld. Keep product container cool, dry, and away from sources of ignition. Use and store this product with adequate ventilation. Keep containers tightly closed when not in use. Product may corrode, degrade, or otherwise react with some metals and plastics upon prolonged contact.
<b>Other Precautions and/or Special Hazards:</b> The following complies with the California safe Drinking Water and Toxic Enforcement Act of 1986: Warning: This product contains a chemical(s) known to the state of California to cause cancer Warning: This product contains a chemical(s) known to the state of California to cause birth defects and/or other reproductive harm.